

Cable to Steel Surface

Mold Information:

- Molds listed are for stranded cable. For solid conductor, add suffix "S" after conductor number. i.e. 4S = 4 AWG solid conductor.
- Price Key is the **Bold Letter** in the Mold Part No.
- For **VH** mold Wear Plates, add suffix "WP" to the end of the Mold Part No. See page 315 for details.


Required Tools & Accessories:

MH1 - Handle for "B" Price Key Molds

Recommended Tools & Accessories:


CCBRSH1 - Cable Cleaning Brush

MCBRSH1 - Mold Cleaning Brush

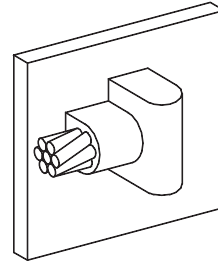

VL

(Horizontal Dead End Cable to Vertical Flat Steel Surface[◊])

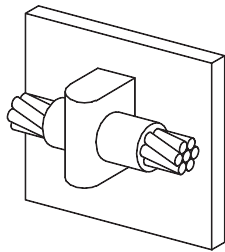

VH

(Horizontal Thru Cable to Vertical Flat Steel Surface)

VL Connection Type


Cable Size	Mold Part No.	Weld Metal	
		UltraShot	NUWTUBE
#6	VL-6B	US45	NUWTUBE45
#4	VL-4B	US45	NUWTUBE45
#2 Sol	VL-2SB	US45	NUWTUBE45
#2	VL-2B	US45	NUWTUBE45
1/0	VL-1/0B	US90	NUWTUBE90
2/0	VL-2/0B	US90	NUWTUBE90
3/0	VL-3/0B	US115	NUWTUBE115
4/0	VL-4/0B	US115	NUWTUBE115
250 MCM	VL-25CMB	US115	NUWTUBE115
300 MCM	VL-3CMB	US150	NUWTUBE150
350 MCM	VL-35CMB	US200	NUWTUBE200
500 MCM	VL-5CMB	US200	NUWTUBE200

VH Connection Type

Cable Size	Mold Part No.	Weld Metal	
		UltraShot	NUWTUBE
#6	VH-6B	US65	NUWTUBE65
#4	VH-4B	US65	NUWTUBE65
#2 Sol	VH-2SB	US65	NUWTUBE65
#2	VH-2B	US65	NUWTUBE65
1/0	VH-1/0B	US115	NUWTUBE115
2/0	VH-2/0B	US115	NUWTUBE115
3/0	VH-3/0B	US150	NUWTUBE150
4/0	VH-4/0B	US150	NUWTUBE150
250 MCM	VH-25CMB	US150	NUWTUBE150

◊NOTES:

- VL is a Left Hand mold.
- To order a Right Hand mold, change the VL in the Mold Part No. to VR. Example: VR-6B.

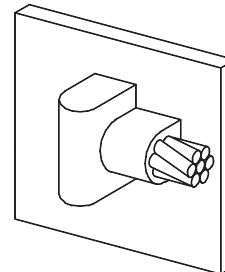

VR

(Horizontal Dead End Cable to Vertical Flat Steel Surface[◊])