

## Cable to Reinforcing Steel

### Mold Information:


- Molds listed are for stranded cable. For solid conductor, add suffix "S" after conductor number. i.e. 4S = 4 AWG solid conductor.
- Price Key is the **Bold Letter** in the Mold Part No.
- For mold Wear Plates, add suffix "WP" to the end of the Mold Part No. See page 315 for details.

### Required Tools & Accessories:

MH1 - Handle for "B" and "Q" Price Key Molds  
WRPSLV or CERPM - Packing Material  
UMHDKIT - Hold Down Kit

### Recommended Tools & Accessories:

CCBRSH1 - Cable Cleaning Brush  
MCBRSH1 - Mold Cleaning Brush

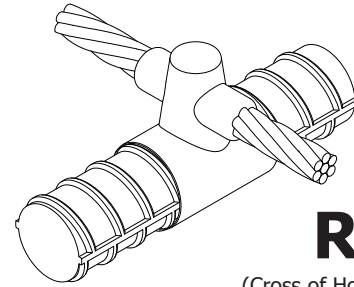


# RO

(Cross of Horizontal Cable Lapped Over Horizontal Reinforcing Steel)


US Listed 467

### RO Connection Type

Size	Cable Size	Mold Part No.	Packing Mat'l No.	Weld Metal	
				UltraShot	NUWTUBE
3	#6	RO-36B	WRPSLV	US65	NUWTUBE65
	#4	RO-34B	WRPSLV	US65	NUWTUBE65
	#2 Sol	RO-32SB	WRPSLV	US90	NUWTUBE90
	#2	RO-32B	WRPSLV	US90	NUWTUBE90
	1/0	RO-31/0Q	WRPSLV	US115	NUWTUBE115
	2/0	RO-32/0Q	WRPSLV	US115	NUWTUBE115
	3/0	RO-33/0Q	WRPSLV	US150	NUWTUBE150
4	#6	RO-46B	WRPSLV	US65	NUWTUBE65
	#4	RO-44B	WRPSLV	US65	NUWTUBE65
	#2 Sol	RO-42SB	WRPSLV	US90	NUWTUBE90
	#2	RO-42B	WRPSLV	US90	NUWTUBE90
	1/0	RO-41/0Q	WRPSLV	US115	NUWTUBE115
	2/0	RO-42/0Q	WRPSLV	US115	NUWTUBE115
	3/0	RO-43/0Q	WRPSLV	US150	NUWTUBE150
5	#6	RO-56B	WRPSLV	US65	NUWTUBE65
	#4	RO-54B	WRPSLV	US65	NUWTUBE65
	#2 Sol	RO-52SB	WRPSLV	US90	NUWTUBE90
	#2	RO-52B	WRPSLV	US90	NUWTUBE90
	1/0	RO-51/0Q	WRPSLV	US115	NUWTUBE115
	2/0	RO-52/0Q	WRPSLV	US115	NUWTUBE115
	3/0	RO-53/0Q	WRPSLV	US150	NUWTUBE150
6** & Larger	#6	RO-6L6B	CERPM1	US65	NUWTUBE65
	#4	RO-6L4B	CERPM1	US65	NUWTUBE65
	#2 Sol	RO-6L2SB	CERPM1	US90	NUWTUBE90
	#2	RO-6L2B	CERPM1	US90	NUWTUBE90
	1/0	RO-6L1/0B	CERPM2	US115	NUWTUBE115
	2/0	RO-6L2/0B	CERPM2	US115	NUWTUBE115
	3/0	RO-6L3/0B	CERPM2	US150	NUWTUBE150
4/0	RO-6L4/0B	CERPM2	US150	NUWTUBE150	



UMHDKIT

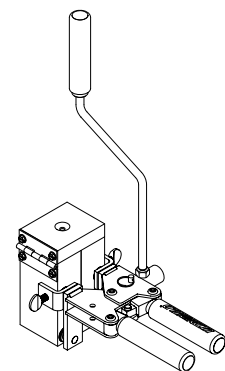

UMHDKIT with Mold & Handle

Patented

\*\* Requires #UMHDKIT Hold Down Kit for welds made to #6 and Larger reinforcing steel.

- (2) #WRPSLV Wrap Sleeve required per weld.
- (1) #CERPM1 or #CERPM2 Ceramic Packing Material required per weld.

**Important: See Packing Material Notes On Page 295.**