

Cable to Cable

Mold Information:

- **PS** molds listed are for solid or concentric stranded copper conductors.
- **PT** molds listed are for stranded cable. For solid conductor, add suffix "S" after conductor number. i.e. 4S = 4 AWG solid conductor.
- Price Key is the **Bold Letter** in the Mold Part No.
- Molds with Price Key "**L**" & "**M**" SOLD WITH HANDLES.
- If Handles not required, add suffix "-X" after the Mold Part No.
- Handles for "**L**" & "**M**" Price Key molds DO NOT INCLUDE Flint Igniters.
- For mold Wear Plates, add suffix "WP" to the end of the Mold Part No.

See page 315 for details.

Required Tools & Accessories:

MH1 - Handle for "**B**" Price Key Molds

FLTIG - Flint Igniter when Price Key is "**L**" & "**M**"


Recommended Tools & Accessories:

CCBRSH1 - Cable Cleaning Brush

MCBRSH1 - Mold Cleaning Brush

PT Connection Type continued

Cable Size		Mold Part No.	Weld Metal		
Run	Tap		UltraShot	Ultraweld	
#2 Sol	#2 Sol	PT-2S2SB	US65	NUWTUBE65	
#2	#8 Sol	PT-28SB	US45	NUWTUBE45	
	#8	PT-28B	US45	NUWTUBE45	
	#6 Sol	PT-26SB	US45	NUWTUBE45	
	#6	PT-26B	US45	NUWTUBE45	
	#4	PT-24B	US65	NUWTUBE65	
#2 Sol	#2 Sol	PT-22SB	US65	NUWTUBE65	
	#2	PT-22B	US65	NUWTUBE65	
	1/0	#8 Sol	PT-1/08SB	US65	NUWTUBE65
		#8	PT-1/08B	US65	NUWTUBE65
		#6 Sol	PT-1/06SB	US65	NUWTUBE65
#6		PT-1/06B	US65	NUWTUBE65	
#4		PT-1/04B	US65	NUWTUBE65	
#2 Sol	#2 Sol	PT-1/02SB	US65	NUWTUBE65	
	#2	PT-1/02B	US65	NUWTUBE65	
	1/0	PT-1/01/0B	US90	NUWTUBE90	
	2/0	#8 Sol	PT-2/08SB	US65	NUWTUBE65
		#8	PT-2/08B	US65	NUWTUBE65
#6 Sol		PT-2/06SB	US90	NUWTUBE90	
#6		PT-2/06B	US90	NUWTUBE90	
#4		PT-2/04B	US90	NUWTUBE90	
#2 Sol	#2 Sol	PT-2/02SB	US90	NUWTUBE90	
	#2	PT-2/02B	US90	NUWTUBE90	
	1/0	PT-2/01/0B	US115	NUWTUBE115	
	2/0	PT-2/02/0B	US115	NUWTUBE115	
	3/0	#8 Sol	PT-3/08SB	US90	NUWTUBE90
#8		PT-3/08B	US90	NUWTUBE90	
#6 Sol		PT-3/06SB	US90	NUWTUBE90	
#6		PT-3/06B	US90	NUWTUBE90	
#4		PT-3/04B	US115	NUWTUBE115	
#2 Sol		PT-3/02SB	US115	NUWTUBE115	
#2		PT-3/02B	US115	NUWTUBE115	
1/0		PT-3/01/0B	US115	NUWTUBE115	
2/0	PT-3/02/0B	US150	NUWTUBE150		
4/0	3/0	PT-3/03/0B	US150	NUWTUBE150	
	#8 Sol	#8 Sol	PT-4/08SB	US90	NUWTUBE90
		#8	PT-4/08B	US90	NUWTUBE90
		#6 Sol	PT-4/06SB	US90	NUWTUBE90
		#6	PT-4/06B	US90	NUWTUBE90
		#4	PT-4/04B	US150	NUWTUBE150
	#2 Sol	#2 Sol	PT-4/02SB	US150	NUWTUBE150
		#2	PT-4/02B	US150	NUWTUBE150
		1/0	PT-4/01/0B	US150	NUWTUBE150
		2/0	PT-4/02/0B	US150	NUWTUBE150
3/0		PT-4/03/0B	US200	NUWTUBE200	
4/0	PT-4/04/0B	US200	NUWTUBE200		

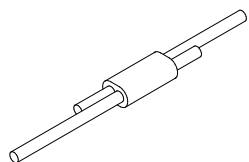


PS

(Parallel Thru Splice of Horizontal Cables)

PS Connection Type

Cable Size		Mold Part No.	Weld Metal	
Run	Tap		UltraShot	NUWTUBE
#8 Sol	#8 Sol	PS-8S8SL	US25	NUWTUBE25
#8	#8	PS-88L	US25	NUWTUBE25
#6 Sol	#6 Sol	PS-6S6SL	US25	NUWTUBE25
#6	#6	PS-66L	US25	NUWTUBE25
#4 Sol	#4 Sol	PS-4S4SM	US32	NUWTUBE32
#4	#4	PS-44M	US32	NUWTUBE32
#2 Sol	#2 Sol	PS-2S2SM	US45	NUWTUBE45

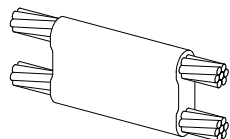

PT

(Parallel Thru Splice of Horizontal Cables, Tap Conductor Over Run)

PT Connection Type

Cable Size		Mold Part No.	Weld Metal	
Run	Tap		UltraShot	NUWTUBE
#6	#6	PT-66B	US25	NUWTUBE25
#4	#8 Sol	PT-48SB	US32	NUWTUBE32
	#8	PT-48B	US32	NUWTUBE32
	#6 Sol	PT-46SB	US32	NUWTUBE32
	#6	PT-46B	US32	NUWTUBE32
	#4	PT-44B	US32	NUWTUBE32

cUL us Listed 467