

Cable to Reinforcing Steel

Mold Information:


- Molds listed are for stranded cable. For solid conductor, add suffix "S" after conductor number. i.e. 4S = 4 AWG solid conductor.
- Price Key is the **Bold Letter** in the Mold Part No.
- For mold Wear Plates, add suffix "WP" to the end of the Mold Part No. See page 315 for details.

Required Tools & Accessories:

- MH1 - Handle for "B" and "P" Price Key Molds
- WRPSLV or CERPM - Packing Material
- **CSKITHSVM - Chain Support Kit for #7 and Larger reinforcing steel

Recommended Tools & Accessories:

- CCBRSH1 - Cable Cleaning Brush
- MCBRSH1 - Mold Cleaning Brush

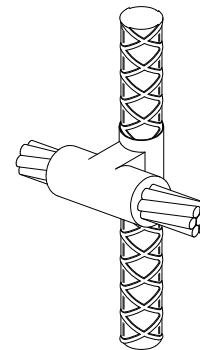

RS
(Horizontal Thru Cable to Side of Vertical Reinforcing Steel)

RS Connection Type


Size	Cable Size	Mold Part No.	Packing Mat'l No.	Weld Metal	
				UltraShot	NUWTUBE
3	#6	RS-36P	WRPSLV	US90	NUWTUBE90
	#4	RS-34P	WRPSLV	US90	NUWTUBE90
	#2 Sol	RS-32SP	WRPSLV	US90	NUWTUBE90
	#2	RS-32P	WRPSLV	US90	NUWTUBE90
	1/0	RS-31/0P	WRPSLV	US115	NUWTUBE115
	2/0	RS-32/0P	WRPSLV	US115	NUWTUBE115
	3/0	RS-33/0P	WRPSLV	US150	NUWTUBE150
	4/0	RS-34/0P	WRPSLV	US150	NUWTUBE150
4	#6	RS-46P	WRPSLV	US90	NUWTUBE90
	#4	RS-44P	WRPSLV	US90	NUWTUBE90
	#2 Sol	RS-42SP	WRPSLV	US90	NUWTUBE90
	#2	RS-42P	WRPSLV	US90	NUWTUBE90
	1/0	RS-41/0P	WRPSLV	US115	NUWTUBE115
	2/0	RS-42/0P	WRPSLV	US115	NUWTUBE115
	3/0	RS-43/0P	WRPSLV	US150	NUWTUBE150
	4/0	RS-44/0P	WRPSLV	US150	NUWTUBE150
5	#6	RS-56P	WRPSLV	US90	NUWTUBE90
	#4	RS-54P	WRPSLV	US90	NUWTUBE90
	#2 Sol	RS-52SP	WRPSLV	US90	NUWTUBE90
	#2	RS-52P	WRPSLV	US90	NUWTUBE90
	1/0	RS-51/0P	WRPSLV	US115	NUWTUBE115
	2/0	RS-52/0P	WRPSLV	US115	NUWTUBE115
	3/0	RS-53/0P	WRPSLV	US150	NUWTUBE150
	4/0	RS-54/0P	WRPSLV	US150	NUWTUBE150

RS Connection Type continued


Size	Cable Size	Mold Part No.	Packing Mat'l No.	Weld Metal	
				UltraShot	NUWTUBE
6	#6	RS-66P	WRPSLV	US90	NUWTUBE90
	#4	RS-64P	WRPSLV	US90	NUWTUBE90
	#2 Sol	RS-62SP	WRPSLV	US90	NUWTUBE90
	#2	RS-62P	WRPSLV	US90	NUWTUBE90
	1/0	RS-61/0P	WRPSLV	US115	NUWTUBE115
	2/0	RS-62/0P	WRPSLV	US115	NUWTUBE115
	3/0	RS-63/0P	WRPSLV	US150	NUWTUBE150
	4/0	RS-64/0P	WRPSLV	US150	NUWTUBE150
7** & Larger	#6	RS-7L6B	CERPM3	US90	NUWTUBE90
	#4	RS-7L4B	CERPM3	US90	NUWTUBE90
	#2 Sol	RS-7L2SB	CERPM3	US90	NUWTUBE90
	#2	RS-7L2B	CERPM3	US90	NUWTUBE90
	1/0	RS-7L1/0B	CERPM3	US115	NUWTUBE115
	2/0	RS-7L2/0B	CERPM3	US115	NUWTUBE115
	3/0	RS-7L3/0B	CERPM3	US150	NUWTUBE150
	4/0	RS-7L4/0B	CERPM3	US150	NUWTUBE150

** Requires #CSKITHSVM Chain Support Kit for welds made to #7 and Larger reinforcing steel.

- (1) #WRPSLV Wrap Sleeve required per weld.
- (1) #CERPM3 Ceramic Packing Material required per weld.

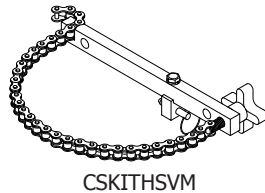

Patented

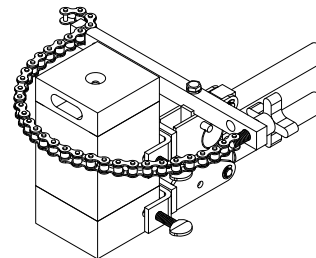

Important: See Packing Material Notes On Page 295.