




## Uni-Shots - UltraShot

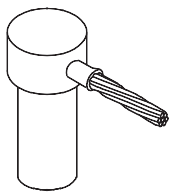


**G11**

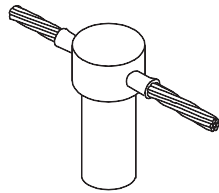


**G21**

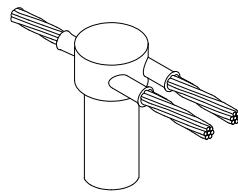

**G31**

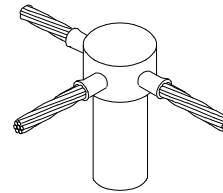

**G31\***

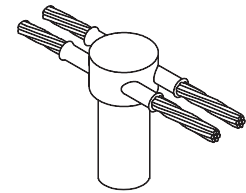


**G41**

Type	Cable Sizes		Ground Rod			
	Solid	Stranded	5/8 Copper Clad	5/8 Full	3/4 Copper Clad	3/4 Full
G11	#6, #8	#8	G11-588US	G11-58F8US	G11-348US	G11-34F8US
G11	#3, #4	#4, #6	G11-584US	G11-58F4US	G11-344US	G11-34F4US
G11	#1, #2	#2, #3	G11-582US	G11-58F2US	G11-342US	G11-34F2US
G11	2/0, 1/0	1/0, #1	G11-581/0US	G11-58F1/0US	G11-341/0US	G11-34F1/0US
G11	-	2/0	G11-582/0US	G11-58F2/0US	G11-342/0US	G11-34F2/0US
G11	-	4/0	G11-584/0US	G11-58F4/0US	G11-344/0US	G11-34F4/0US
G21	#6, #8	#8	G21-588US	G21-58F8US	G21-348US	G21-34F8US
G21	#3, #4	#4, #6	G21-584US	G21-58F4US	G21-344US	G21-34F4US
G21	#1, #2	#2, #3	G21-582US	G21-58F2US	G21-342US	G21-34F2US
G21	2/0, 1/0	1/0, #1	G21-581/0US	G21-58F1/0US	G21-341/0US	G21-34F1/0US
G21	-	2/0	G21-582/0US	G21-58F2/0US	G21-342/0US	G21-34F2/0US
G21	-	4/0	G21-584/0US	G21-58F4/0US	G21-344/0US	G21-34F4/0US
G31	#6, #8	#8	G31-588US	G31-58F8US	G31-348US	G31-34F8US
G31	#3, #4	#4, #6	G31-584US	G31-58F4US	G31-344US	G31-34F4US
G31	#1, #2	#2, #3	G31-582US	G31-58F2US	G31-342US	G31-34F2US
G31	2/0, 1/0	1/0, #1	G31-581/0US*	G31-58F1/0US*	G31-341/0US*	G31-34F1/0US*
G41	#6, #8	#8	G41-588US	G41-58F8US	G41-348US	G41-34F8US
G41	#3, #4	#4, #6	G41-584US	G41-58F4US	G41-344US	G41-34F4US
G41	#1, #2	#2, #3	G41-582US	G41-58F2US	G41-342US	G41-34F2US

**NOTES:**

- Disposable single use ceramic mold provides convenience and ease of use.
- Packaged 12 per box.
- No frames or handle clamps are required.
- DRONE or USCONTROLLER required to make UltraShot Uni-Shot connection. See page 312.

Use locking pliers to support mold

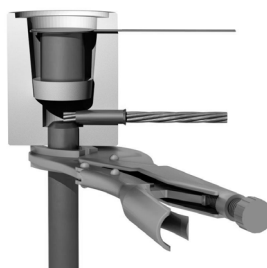

UltraShot  
(Drop-in)

